


### FEATURES

- Conductivity measure throughout inductive sensor.
- The inductive sensor design eliminates polarization errors and electrode coating problems that commonly affect conventional conductivity contacting-electrode models.
- PT100 temperature compensation.
- High pressure (8 bar) and temperature (up to 85°C) specifications.
- Wide conductivity range (up to 300 mS).

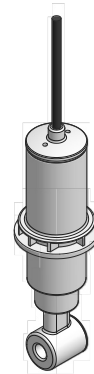


### Inductive conductivity measurement technique: operating principle

Inductive conductivity sensor induces a low current in a closed loop of solution, then measures the magnitude of this current to determine the solution's conductivity.

The conductivity probe drives Toroid A, inducing an alternating current in the solution. This current signal flows in a closed loop through the sensor bore and surrounding solution.

Toroid B senses the magnitude of the induced current which is proportional to the conductance of the solution.

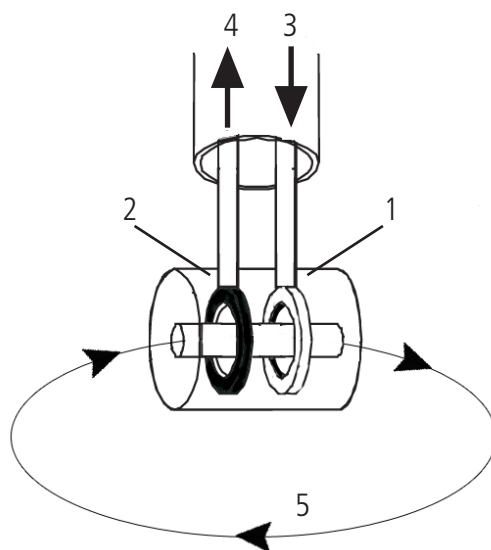


- 1 - Toroid A
- 2 - Toroid B
- 3 - Alternate current generator
- 4 - Receiver
- 5 - Induced current in the solution

### ECDIND PT

Range:	0-3 mS; 0-30 mS; 0-300 mS
Analysys system:	inductive
Temperature:	85° C (185°F)
Pressure max:	8 bar (116 PSI)
Cable/connector:	G1 and NPT 3/4"
Cable length:	4 mt
Material:	PEEK
Temperature sensor:	PT100
Probe holder:	PEL-IND

### DIMENSIONS


expressed in mm

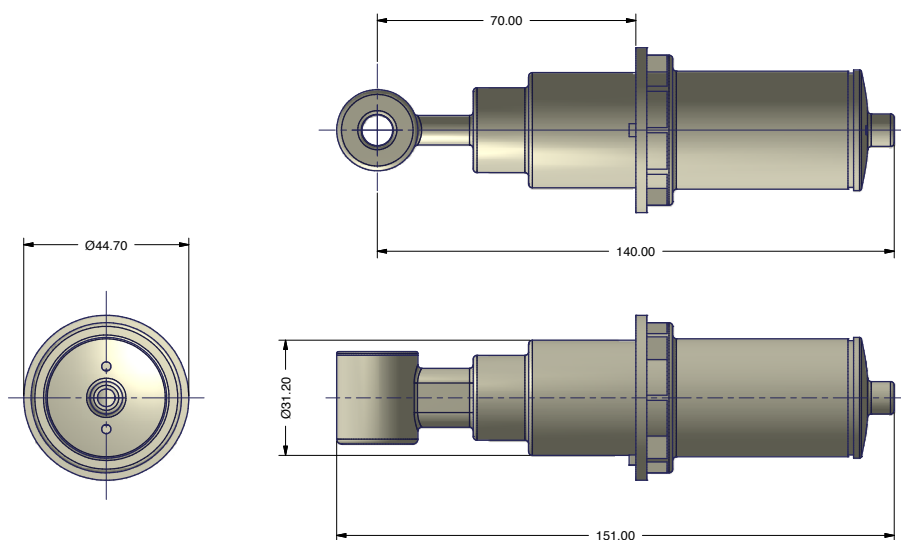

### ACCESSORIES

For updated list of accessories refer to technical datasheet.

### ASSEMBLIES

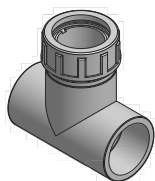

- PEL-IND - PVC in-line probe holder for "T" connection (PN 16  $\varnothing 40$ ). Max 40°C, 7 bar.

The process flow must be directed through the hole.

The inductive conductivity measurement technique requires a process fluid surrounding the sensor.

